



ESPACE

Type

JE0 K

JE0 S

Fabrication cut-offs

K 000001	to	K 003553
T 000001	to	T 039099
K 000001	to	K 007316
T 000001	to	T 014624

fitted with G9T 710 engine

88A ENGINE JERKING WITH INJECTION WARNING LIGHT COMING ON

Other sub-section concerned:

13B

83A

- Engine: **G9T 710**
- Gearbox: **XXX**

Basic manual: **XXX**

TECHNICAL INFORMATION

Customer complaint

- Engine jerking with injection warning light coming on.

Possible cause

- Engine wiring harness coming into contact with the air conditioning high-pressure pipe and/or the engine accessories mounting.

Fault finding

- The following fault codes may appear on the diagnostic tool:
 - DF099 1.DEF
 - DF100 1.DEF
 - DF101 1.DEF
 - DF102 1.DEF.
- Check whether the engine wiring harness is coming into contact with air conditioning high-pressure pipe and/or the engine accessories mounting.

Description of the operation

- Repair the engine wiring harness and insulate it using adhesive tape.
- Fit the mounting kit.

Note: fitting instructions are supplied with the kit.

CLAIM COMPLETION AND CODING

When to take action

- Upon receipt of a customer complaint.

Parts required:

Quantity and description of parts		Part No.
1	Mounting kit	60 25 371 792

Time required

Code	Description	Time
7522	Repair wiring harness	0.3
7521	Fit a mounting kit	0.2
TOTAL		0.5

Coding

- **With PG&CS**

- Catalogue function:

Description	Code
Engine power unit wiring harness	277

- Cause reference: **60 25 371 792**

- **Without PG&CS**

- NITG code: **E2VP**

- **With or without PG&CS**

- Supplier code: **J28**
- Customer complaint code: **7E**

"The repair methods given by the manufacturer in this document are based on the technical specifications current when it was prepared.

The methods may be modified as a result of changes introduced by the manufacturer in the production of the various component units and accessories from which his vehicles are constructed.

All copyrights reserved by RENAULT.

Copying or translating, in part or in full, of this document or use of the service part reference numbering system is forbidden without the prior written authority of RENAULT.