



Factory and fabrication cut-off

S/Section

ESPACE

List below

31

31 NOISE IN THE FRONT AXLE GEOMETRY

Other sub-section concerned:

09

- Engines: **XXX**
- Gearbox: **XXX**

Basic manual:
Workshop Repair Manual 315

LIST OF VEHICLES CONCERNED

TYPE	From	To
JE0 A	T 000001	T 052047
JE0 D	T 000001	T 004192
JE0 E	K 000001	K 009379
	T 000001	T 074864
JE0 G	T 000001	T 010216
JE0 H	K 000001	K 001874
	T 000001	T 012324
JE0 K	K 000001	K 000346
	T 000001	T 003828
JE0 L	T 000001	T 002471
JE0 M	T 000001	T 004653
JE0 N	T 000001	T 030373
JE0 P	K 000001	K 016345
	T 000001	T 031522
JE0 S	K 000001	K 000576
	T 000001	T 001342
JE2 A	T 000001	T 001006

"The repair methods given by the manufacturer in this document are based on the technical specifications current when it was prepared.

The methods may be modified as a result of changes introduced by the manufacturer in the production of the various component units and accessories from which his vehicles are constructed."

All copyrights reserved by Renault.

Copying or translating, in part or in full, of this document or use of the service part reference numbering system is forbidden without the prior written authority of Renault.

FRONT AXLE ELEMENTS

Suspension housing

31

CUSTOMER COMPLAINT

- Noise from the front axle.

POSSIBLE CAUSE

- Damper rod supporting area collapsed onto the upper mount.

CLAIM COMPLETION AND CODING

Destination of removed parts:

- As per Warranty Policy and Procedures Manual.

NITG Code:	L415
Supplier Code:	J28
Customer Complaint Code:	2D
Operation Code:	3381
Time allowed:	1.9 hours

AFTER-SALES SOLUTION

Operation to be carried out:

- Replacement of front damper upper mounts.

Vehicles concerned:

- See vehicle types and fabrication cut-off details on page 1.

When to take action:

- Upon receipt of a customer complaint.

Parts required:

- | | |
|-----------------------|--------------------------------|
| – 1 left front mount | Part No.: 60 25 305 979 |
| – 1 right front mount | Part No.: 60 25 305 980 |

Tooling required:

- Conventional.

Description of the operation:

- Replace the front damper upper mounts (according to Workshop Repair Manual 315).